


IMPORTANT WARNING WHEN REPLACING A CONTROLLER ON OPxxx, OMAXI, OMINI

On some old osmosers, the cable bundle has no white wire on the 4th pin of the connector.



old cable bundle:

standard OPxxx, OMAXI, OMINI cable bundle:

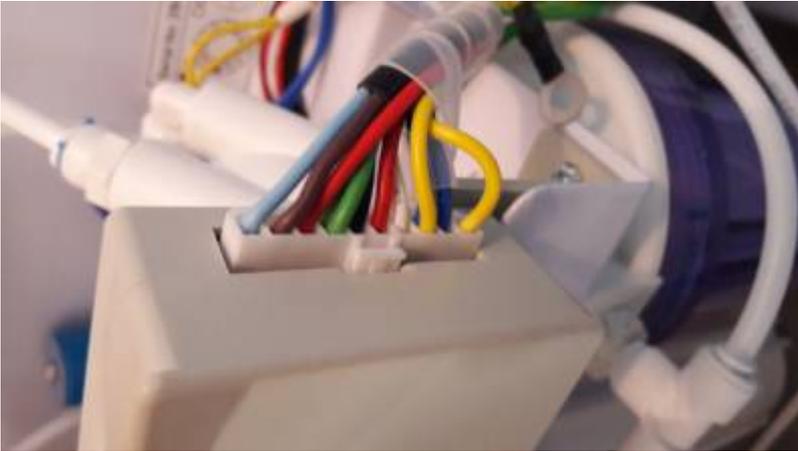


ANY CABLE BUNDLE WITHOUT WHITE WIRE ON PIN 4 MUST BE REPLACED BEFORE CONNECTING A NEW CONTROLLER !!!

(in such a case, the internal fuse will burn and the osmoser will not work)

CONNECTION OF THE ELECTRIC CABLE BUNDLE

[Original file](#)

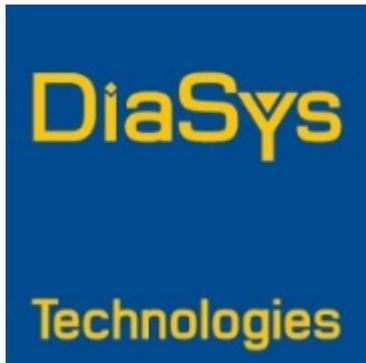

WIRE	CONNECTED TO
Cable 1 Yellow	 <p data-bbox="432 1211 1042 1249">Low Pressure Switch</p>
Cable 2 Blue	 <p data-bbox="432 1850 1042 1888">Cable connector of the High Pressure Switch</p>

Cable 3 Red




Low Solenoid Valve

Cable 4 Green Black



T jonction

Cable 5 Green White

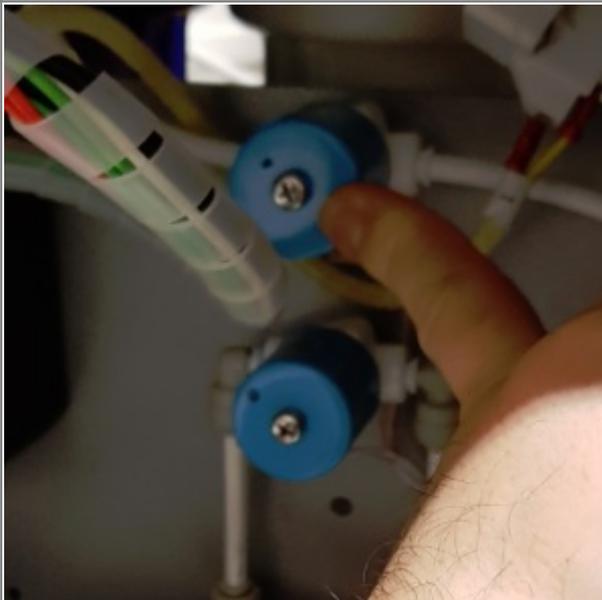

High Solenoid Valve

Cable 6 Blue Brown



24V Power supply

From: <https://diasys-technologies.com/waterpurifiers/> - **DiaSys Water Purifier Systems**

Permanent link: https://diasys-technologies.com/waterpurifiers/doku.php?id=replace_controllerwithoutwhitewire&rev=1573833050

Last update: **2019/11/15 15:50**